



Quickstart Guide

<https://weldvr.com>

**VR Welding
Simulator**



Preparation

To begin setup, open the WeldVR carrying case and remove the required components: the Meta Quest headset and controllers, the link cable, and the controller mounts.



Cast to Web


Your computer must be on the same Wi-Fi network as your headset to cast to Meta Quest.


On your computer, open your browser then go to www.oculus.com/casting and log in with Meta Account.

Put your headset on and press  on your controller to open the universal menu.

Select Camera, select Cast.


Select Web, then select Next to connect.

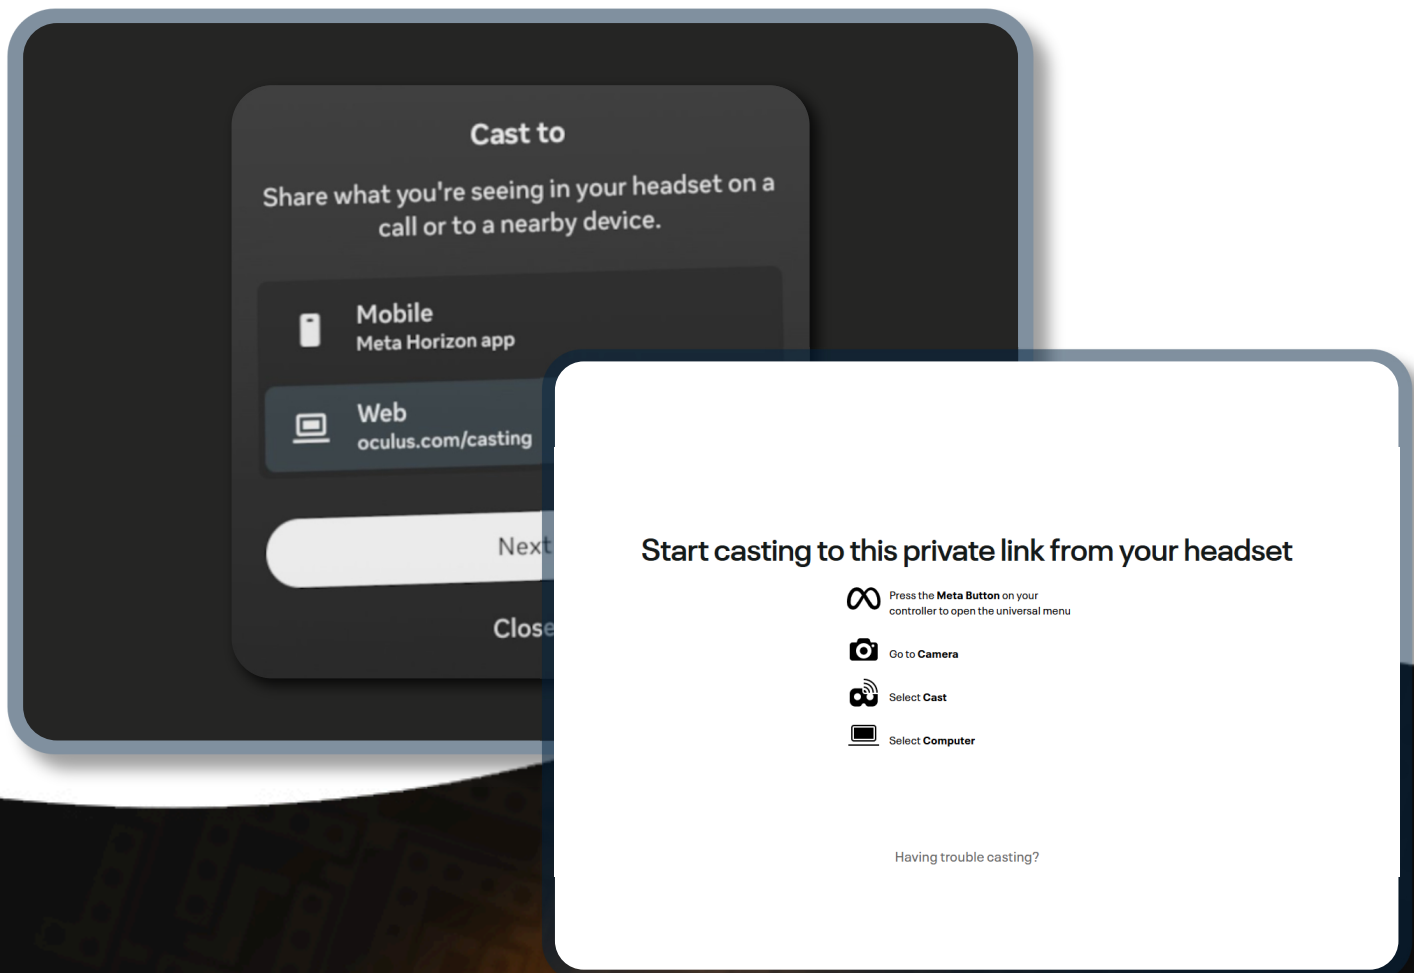

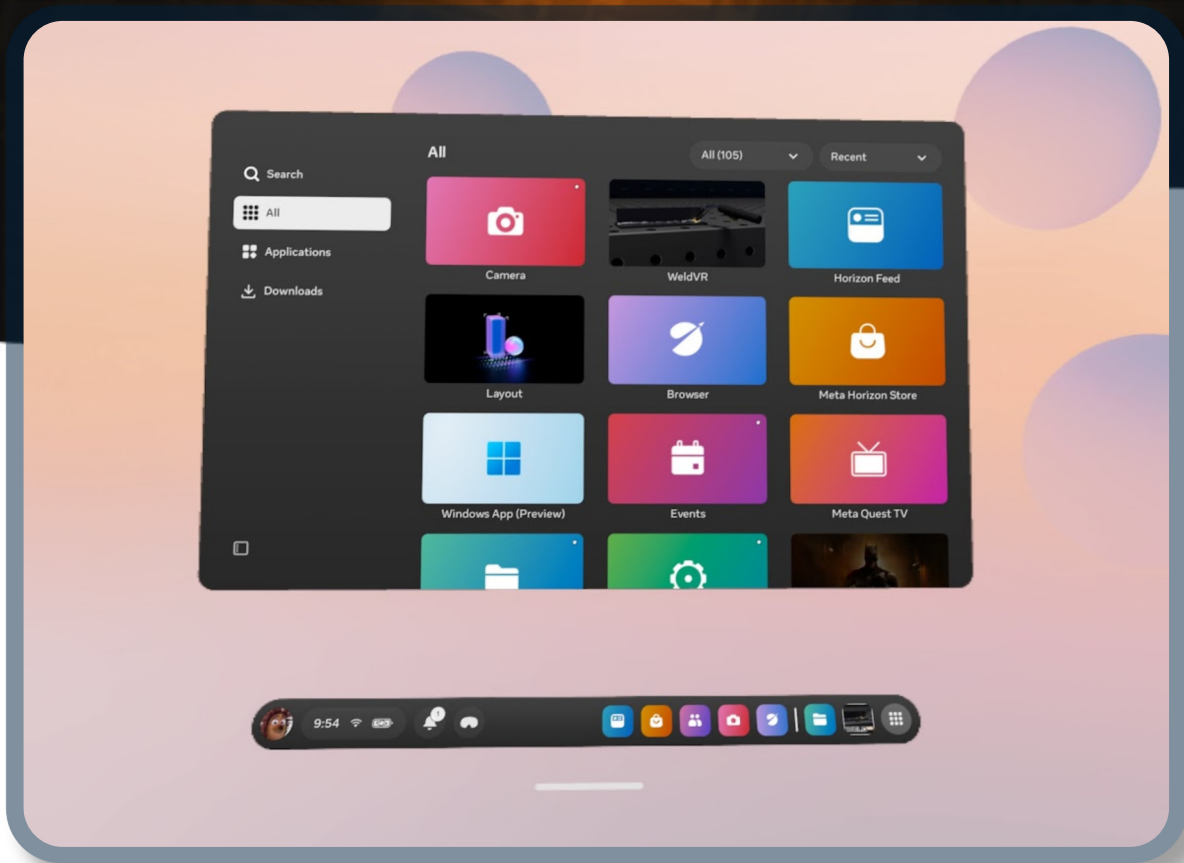

Launching WeldVR

Locate the WeldVR application in the Applications menu on the Meta Quest headset and launch it by selecting its icon.

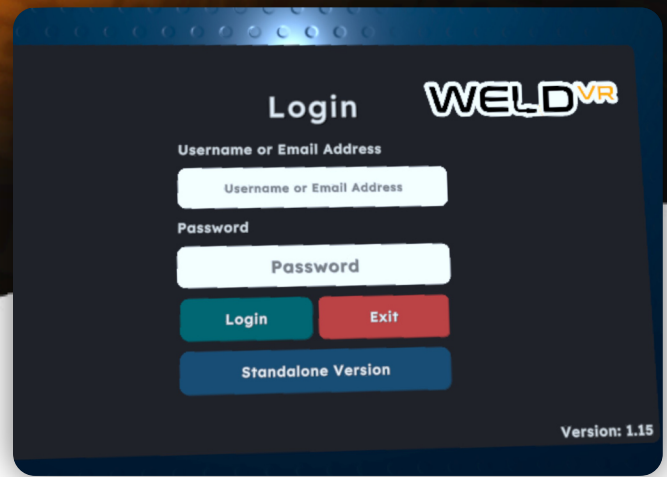


Enterprise Mode and Cloud Analytics

The Enterprise Version enables secure multi-user access, allowing organizations to create and manage multiple accounts while tracking individual user progress and performance.


It also includes a web-based administration panel for managing users, organization settings.

The web-based administration panel provides control for managing users, configuring organizational settings, tracking trainee progress, and generating detailed performance and usage reports.

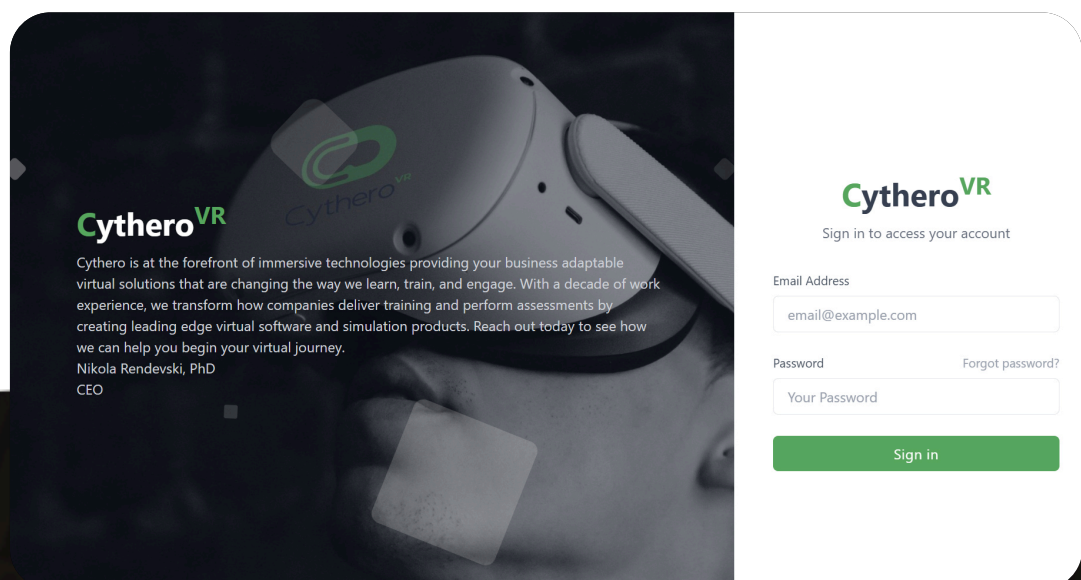


Log in with Trainee profile

After logging in, select a trainee profile from the list displayed on the left side of the screen and enter the associated 4-digit PIN to access the profile. To create a new trainee profile, select the Add New Profile option located in the lower-left corner of the interface.

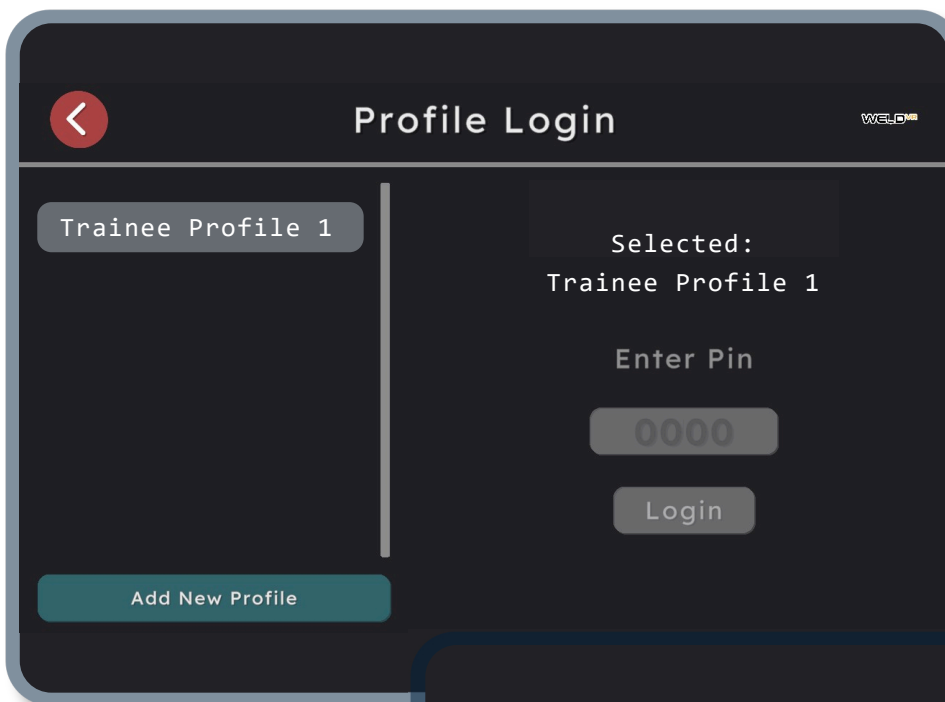

The Profile Login screen features a dark blue header with a back arrow icon on the left, the title "Profile Login" in the center, and a "WELCOME" label on the right. Below the header, the screen is divided into two main sections. On the left, there is a list of trainee profiles, with "Trainee Profile 1" currently selected and highlighted. At the bottom of this list is a teal button labeled "Add New Profile". On the right, the "Selected:" section displays "Trainee Profile 1". Below this, there is a label "Enter Pin" followed by a 4-digit PIN input field showing "0000". A "Login" button is positioned below the PIN field.

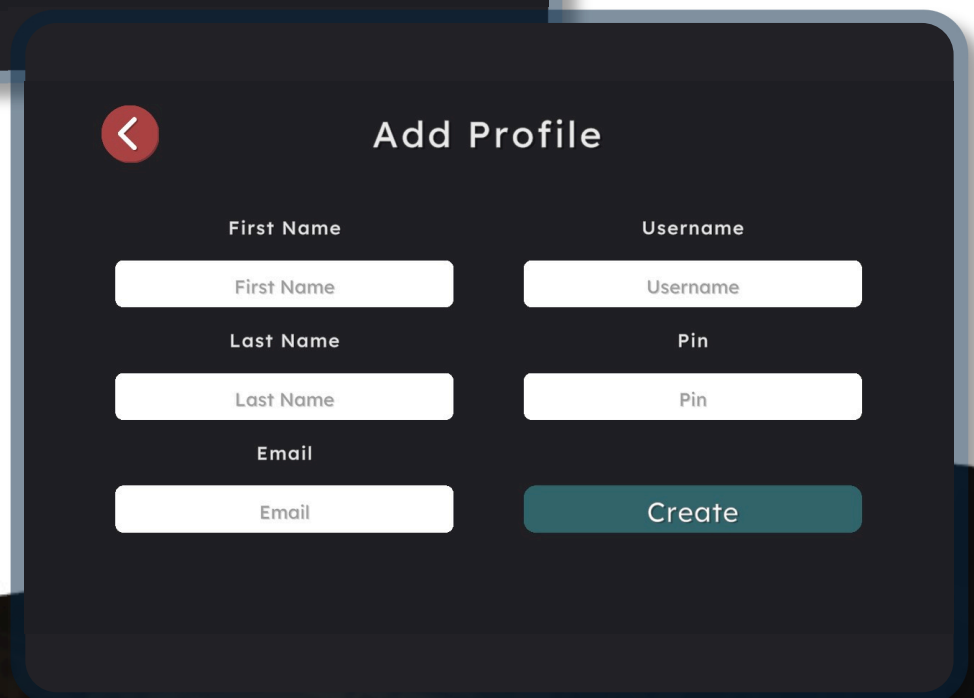

The Add Profile screen has a dark blue header with a back arrow icon on the left and the title "Add Profile" in the center. The form is organized into two columns. The left column contains three input fields labeled "First Name", "Last Name", and "Email". The right column contains two input fields labeled "Username" and "Pin". A teal "Create" button is located at the bottom right of the form.



weldvr@cythero.com

<https://weldvr.com>

info@cythero.com

<https://cythero.com>

